
SPECIFICATION

PART NO. : LT0373-41 3.0mm ROUND LED LAMP



Approved by	Checked by	Prepared by
Sam	Yang	Min Bao

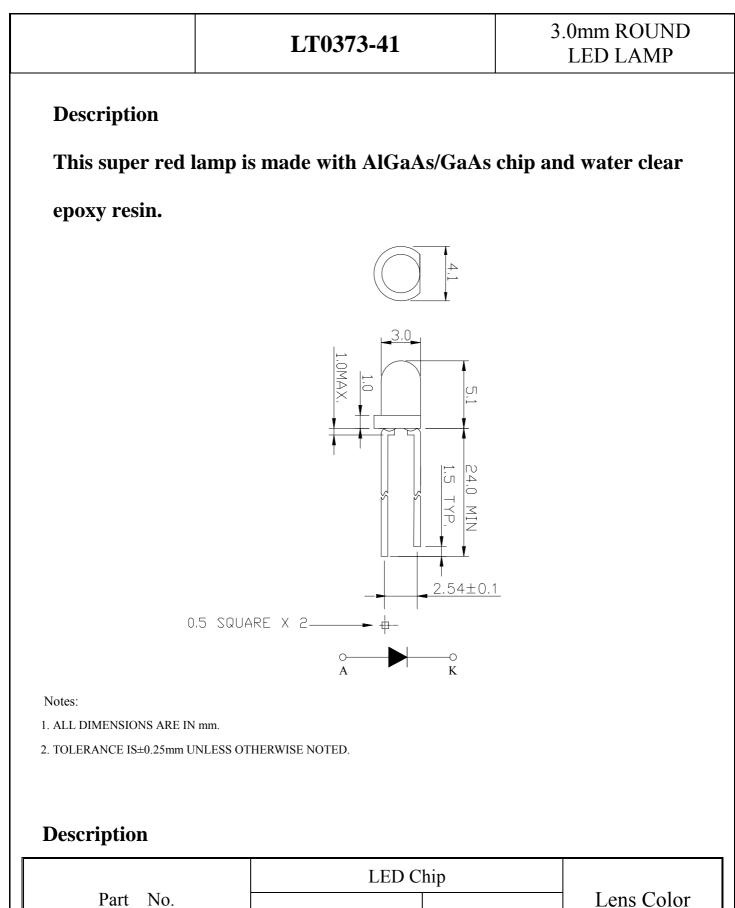


		p	_
Part No.	Material	Emitting Color	Lens Color
LT0373-41	AlGaAs/GaAs	Super red	Water clear

Absolute Maximum Ratings at Ta=25

Parameter	Symbol	Rating	Unit
Power Dissipation	Pd	66	mW
Reverse Voltage	VR	4	V
D.C. Forward Current	If	30	mA
Reverse (Leakage) Current	Ir	100	μA
Peak Current(1/10Duty Cycle,0.1ms Pulse Width.)	If(Peak)	100	mA
Operating Temperature Range	Topr.	-25 to +85	
Storage Temperature Range	Tstg.	-40 to +100	
Lead Soldering Temp.(1.6mm from body) for 5 seconds		260	

Electrical and Optical Characteristics:

Parameter	Symbol	Condition	Min.	Тур.	Max.	Unit
Luminous Intensity	Iv	If=20mA	42.9	100.0		mcd
Forward Voltage	Vf	If=20mA		1.8	2.2	V
Peak Wavelength	λΡ	If=20mA		660		nm
Dominant Wavelength	λD	If=20mA		643		nm
Reverse (Leakage) Current	Ir	Vr=4V			50	μA
Viewing Angle	2 1/2	If=20mA		35		deg
Spectrum Line Halfwidth	Δλ	If=20mA		20		nm
	NOTE: 7	THE DATAS TE	STED BY	IS TES	TER	

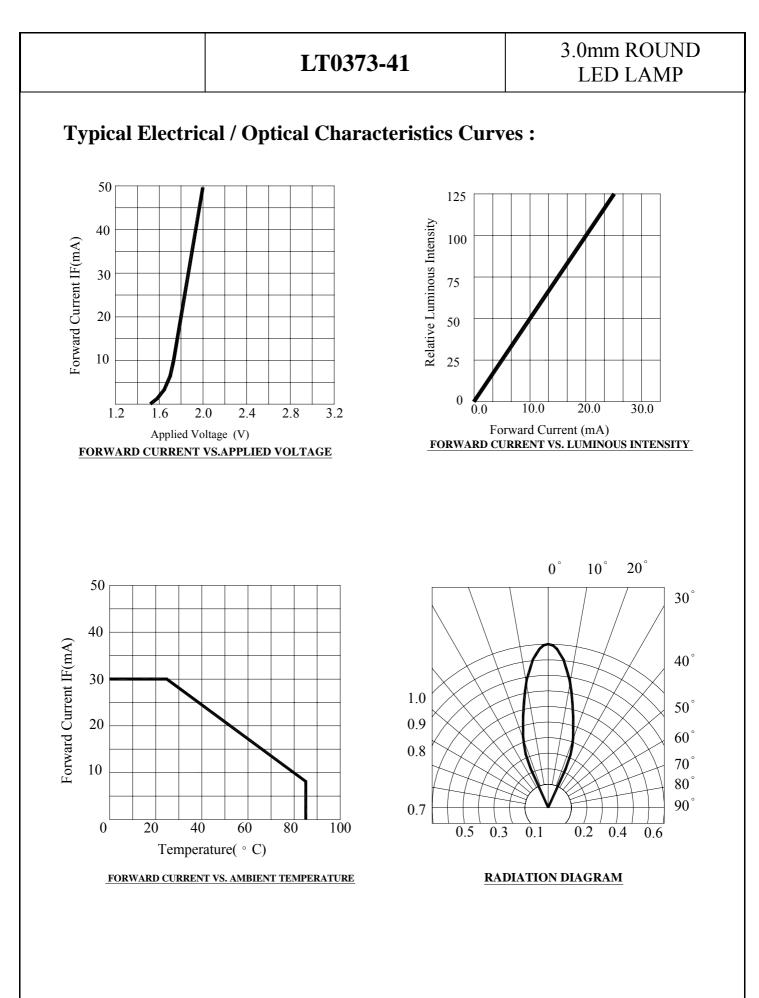

3.0mm ROUND LED LAMP

Precautions:

TAKE NOTE OF THE FOLLOWING IN USE OF LED

1. Temperature in use

Since the light generated inside the LED needs to be emitted to outside efficiently, a resin with high light transparency is used; therefore, additives to improve the heat resistance or moisture resistance (silica gel, etc) which are used for semiconductor products such as transistors cannot be added to the resin.

Consequently, the heat resistant ability of the resin used for LED is usually low; therefore, please be careful on the following during use.

Avoid applying external force, stress, and excessive vibration to the resins and terminals at high temperature. The glass transition temperature of epoxy resin used for the LED is approximately 120-130 .

At a temperature exceeding this limit, the coefficient of liner expansion of the resin doubles or more compared to that at normal temperature and the resin is softened.

If external force or stress is applied at that time, it may cause a wire rupture.

2. Soldering

Please be careful on the following at soldering.

After soldering, avoided applying external force, stress, and excessive vibration until the products go to cooling process (normal temperature), <Same for products with terminal leads>

(1) Soldering measurements:

Distance between melted solder side to bottom of resin shall be 1.6mm or longer.

- (2) Solder dip: Preheat: 90 max. (Backside of PCB), Within 120 seconds
 Solder bath: 250 max. (Solder temperature), Within 5 seconds
- (3) Soldering iron : 250 max. (Temperature of soldering iron tip), Within 3 seconds
- 3. Insertion

Pitch of the LED leads and pitch of mounting holes need to be same

4. Others

Since the heat resistant ability of the LED resin is low, SMD components are used on the same PCB, please mount the LED after adhesive baking process for SMD components. In case adhesive baking is done after LED lamp insertion due to a production process reason, make sure not to apply external force, stress, and excessive vibration to the LED and follow the conditions below.

Baking temperature: 120 max. Baking time: Within 60 seconds

If soldering is done sequentially after the adhesive baking, please perform the soldering after cooling down the LED to normal temperature.

ENCAS	ED TY	PE		
PL A	STIC PA	CKAGE		
		1000 PCS	de e associa Billas	
		H ELECTRONIC D :LTXXXX-XX		
		: PCS		
		:XXXXXXXXX :	X	
	BIN COL			
				1
	ER BOX		70	
		20 PACKE	TS	
101	AL: 20,00	0 PCS		
	PART NO.	LXXXXX-XX-XX		
	LOT NO.	xxxxxxxxx		
	BIN CODE X2	x X X X X Xx	X XXX TOTAL	
	QUANTITY	PCS PCS 1	PCS PCS PCS	
	-			
	-	xxxx , xx , xx		535
	-			533
OUT	DATE	xxxx , xx , xx		533
QUA	DATE TER CART	TON 4 BOX		533
QUA	DATE	TON 4 BOX		533
QUA TOT	DATE ER CART NTITY: 4 AL: 80,00	TON 4 BOX 0 PCS		533
QUA TOT C/T NO. 箱號 PART NO.	DATE ER CART NTITY: 4 AL: 80,00	TON 4 BOX		535
QUA TOT ^{C/T NO.} 箱號 PART NO. 料號 QUANTITY	DATE TER CART NTITY: 4 AL: 80,00	CON 4 BOX 0 PCS		535
QUA TOT ^{C/T NO.} 箱號 PART NO. 料號	DATE TER CART NTITY: 4 AL: 80,00	CON 4 BOX 0 PCS xx xx-xx-xx		
QUA TOT C/T NO. 箱號 PART NO. 料號 QUANTITY 數量 N.W.	DATE TER CART NTITY: 4 AL: 80,00	CON 4 BOX 0 PCS xx xx-xx-xx PCS		
QUA TOT C/T NO. 箱號 PART NO. 料號 QUANTIITY 數量 N.W. 凈重 G.W. 毛重 REMARK	DATE TER CART NTITY: 4 AL: 80,00	CON 4 BOX 0 PCS xx xx-xx-xx PCS KGS		
QUA TOT C/T NO. 箱 號 PART NO. 料 號 QUANTITY 數 量 N.W. 净 重 G.W. 毛 重	DATE TER CART NTITY: 4 AL: 80,00	CON 4 BOX 0 PCS xx xx-xx-xx PCS KGS		
QUA TOT C/T NO. 箱號 PART NO. 料號 QUANTIITY 數量 N.W. 凈重 G.W. 毛重 REMARK	DATE TER CART NTITY: 4 AL: 80,00	CON 4 BOX 0 PCS xx xx-xx-xx PCS KGS		535
QUA TOT C/T NO. 箱號 PART NO. 料號 QUANTIITY 數量 N.W. 凈重 G.W. 毛重 REMARK	DATE TER CART NTITY: 4 AL: 80,00	CON 4 BOX 0 PCS xx xx-xx-xx PCS KGS		
QUA TOT C/T NO. 箱號 PART NO. 料號 QUANTIITY 數量 N.W. 凈重 G.W. 毛重 REMARK	DATE TER CART NTITY: 4 AL: 80,00	CON 4 BOX 0 PCS xx xx-xx-xx PCS KGS		535
QUA TOT C/T NO. 箱號 PART NO. 料號 QUANTIITY 數量 N.W. 凈重 G.W. 毛重 REMARK	DATE TER CART NTITY: 4 AL: 80,00	CON 4 BOX 0 PCS xx xx-xx-xx PCS KGS		
QUA TOT C/T NO. 箱號 PART NO. 料號 QUANTIITY 數量 N.W. 凈重 G.W. 毛重 REMARK	DATE TER CART NTITY: 4 AL: 80,00	CON 4 BOX 0 PCS xx xx-xx-xx PCS KGS		
QUA TOT C/T NO. 箱號 PART NO. 料號 QUANTIITY 數量 N.W. 凈重 G.W. 毛重 REMARK	DATE TER CART NTITY: 4 AL: 80,00	CON 4 BOX 0 PCS xx xx-xx-xx PCS KGS		