


HIGH DENSITY D - SUB SOLDER CONNECTOR

DBH Series

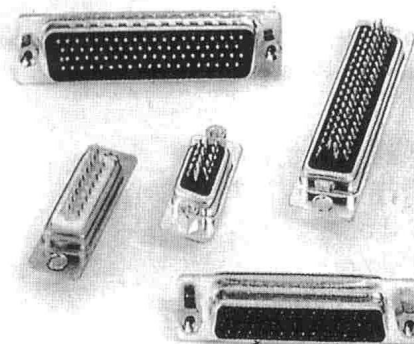


Dimension: $\frac{\text{mm}}{\text{inch}}$


No. Of Contacts	Dim. A	Dim. B	Dim. C Male	Dim. C Female	Dim. D	Dim. E
15	30.81 [1.213]	24.99 [0.984]	16.92 [0.666]	16.33 [0.643]	2.29 [0.090]	19.28 [0.759]
26	39.14 [1.541]	33.32 [1.312]	25.25 [0.994]	24.66 [0.971]	2.29 [0.090]	27.51 [1.083]
44	53.04 [2.088]	47.04 [1.852]	38.96 [1.534]	38.38 [1.511]	2.29 [0.090]	41.30 [1.626]
62	69.32 [2.729]	63.50 [2.500]	55.42 [2.182]	54.84 [2.159]	2.41 [0.095]	57.71 [2.272]
78	66.93 [2.635]	61.11 [2.406]	53.03 [2.088]	52.43 [2.064]	2.41 [0.095]	55.32 [2.178]

MALE

15,26,44 & 62 Positions

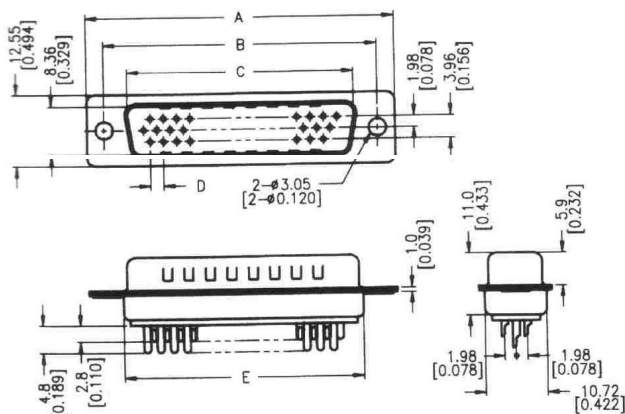


78 Positions

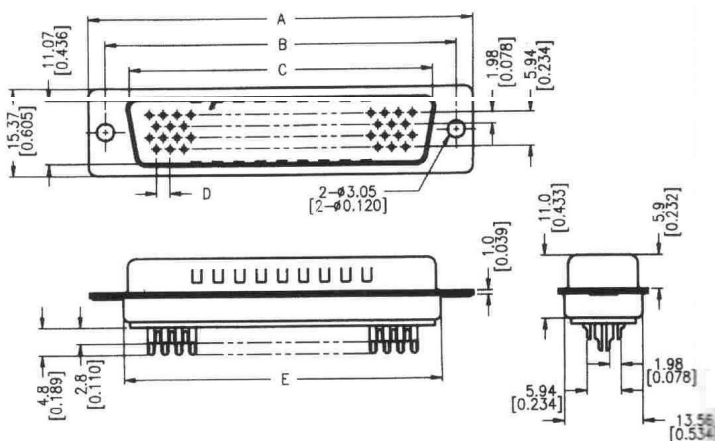


FEMALE

15,26,44 & 62 Positions

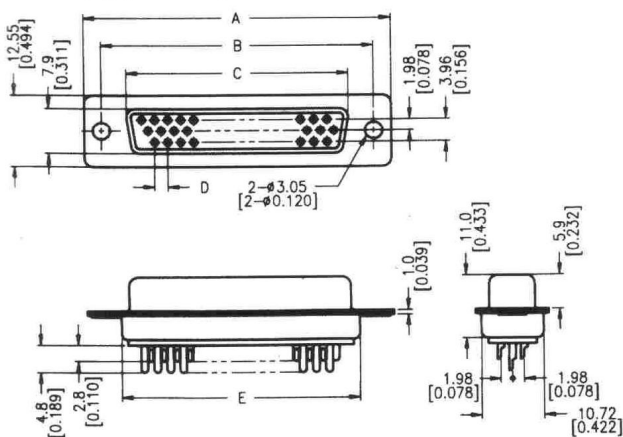

78 Positions

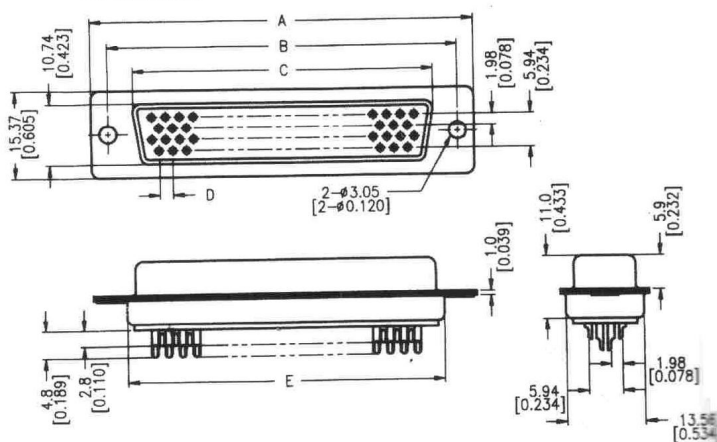


HIGH DENSITY


D - SUB SOLDER CONNECTOR

DBH Series


PROCESS OPTION

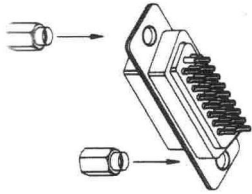

FRONT RIVET

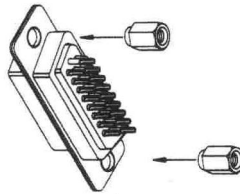

REAR RIVET

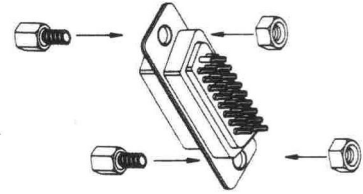

HEX SCREW + HEX NUT

Order Information

DB	A	15	P	G	P	A	A	A	1
1	2	3	4	5	6	7	8	9	10

1. SERIES NO.
DBH

2. TYPE
A=STANDARD

3. CONTACT NUMBER
15 26 44 62 78

4. CONTACT TYPE
P=MALE (BRASS)
A=MALE
(MACHINED CONTACT)
C=MALE
(ONE PIECE BODY)
S=FEMALE (BRASS)
B=FMAL
(MACHINED CONTACT)

5. CONTACT PLATING
S=SELECTIVE GOLD
G=GOLD FLASH
A=5 μ " GOLD
C=15 μ " GOLD
D=30 μ " GOLD

6. SHELL PLATING
T=TIN
N=NICKEL
Z=ZINC(CHROMATIC)
P=TIN+DIMPLE
Q=NICKEL+DIMPLE

7. PROCESS OPTION
A=THRU.HOLE ONLY
B=HEX-SCREW+1.5mm NUT
C=3.8mm OPEN HEX RIVET
D=5.8mm OPEN HEX RIVET
F=2.5mm OPEN HEX RIVET

8. PARTS OPTION
A=NON ACCESSORIES
B=FRONT RIVET
E=REAR RIVET
F=REAR RIVET+LOOSE SCREWS
G=REAR RIVET+FLXED SCREWS

9. CONTACT INSERTING OPTION]
A=FULLY LOADED
B=9 PIN EMPTY

10. INSULATOR COLOR
1=WHITE
2=BLUE
3=BLACK
4=GREY